


4. Check the chain slider (2) for wear.
If the depth of groove exceeds the limit,
the chain slider must be replaced. See
your Honda dealer.

Chain slider depth limit:
6 mm (0.2 in)

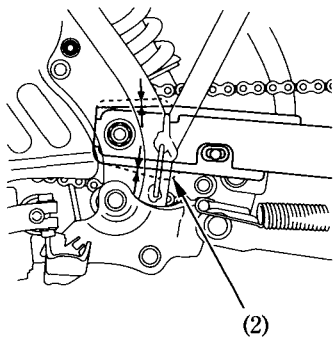

(2) Chain slider


5. Measure a section of the drive chain to
determine whether the chain is worn
beyond its service limit. Remove the drive
chain and measure the distance between
a span of pins from pin center to pin
center. If the distance exceeds the service
limit, the chain is worn out and should be
replaced.

New Chain:

1,384 mm (54.5 in)

Service Limit:

1,412 mm (55.6 in)

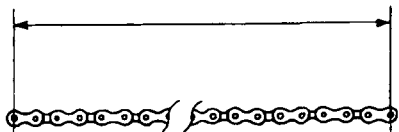

Measure a span of : 109 pins.